


HOMELITE REVISION BLOCK					
REV.	DESCRIPTION	DATE	BY	CHKD BY	DATE
A	SECTION RELEASE				
B	UPPER PARTS PUMP TIRE TIGHTENING				
C	LOWER PARTS PUMP TIRE TIGHTENING				

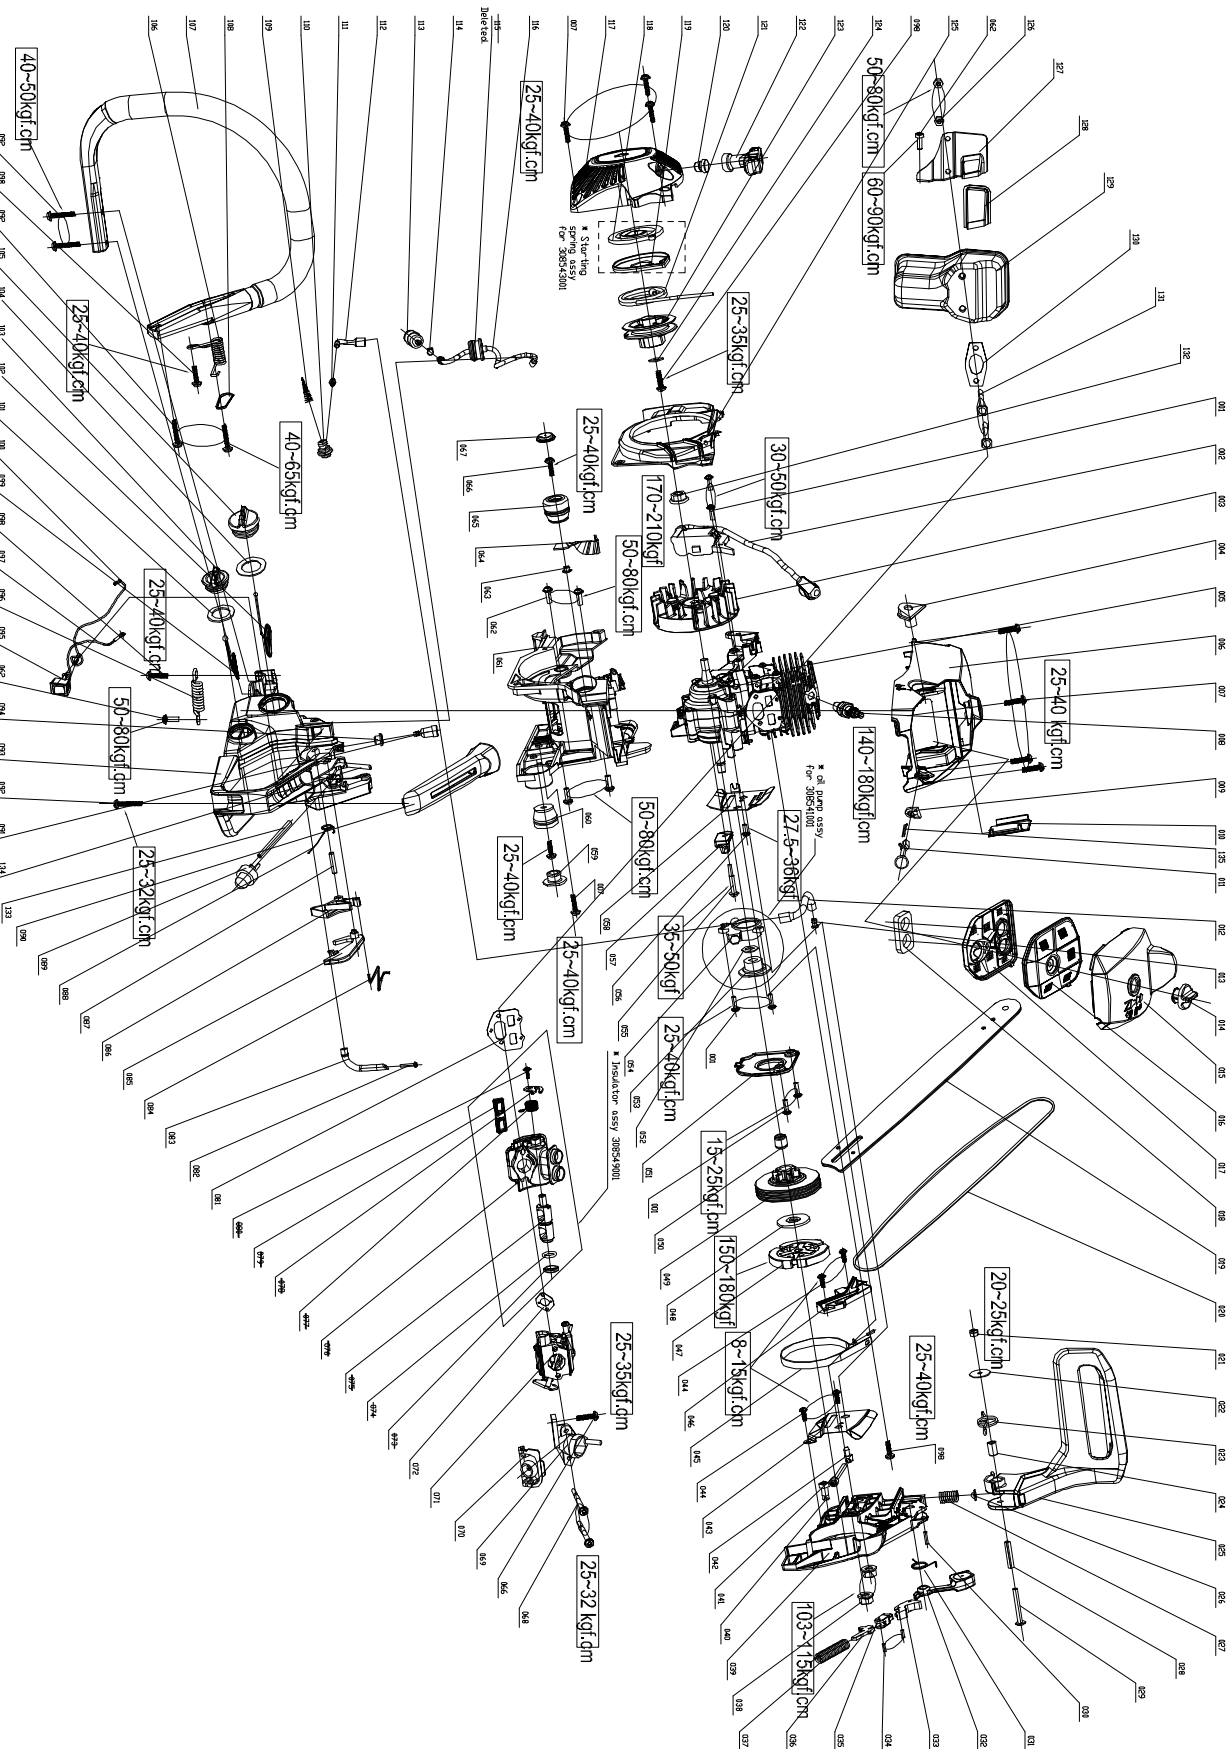

- Notes:
1. The knot for starting rope refer to DDC06587. Add Grease 900909001 to moving parts for starter assy.
 2. Chassis leak test, refer to the picture signed by NPI.
 3. For Item048, the face with flange towards Item049 Drum.
 4. Add several drops silicon oil 900835001 to the import & export for cylinder.
 5. Add Grease 900874001 0.002LB to Item050 Bearing and 0.004LB to Oil pump worm.
 6. For Item068, fix it in two steps: 20kgf.cm by pneumatic tool, tighten to 25~32 kgf.cm by Wrench.

ENGINE					
MODEL NO.	DESCRIPTION	REMARKS			
HOMELITE 35CC 4-STROKE ENGINE	ASIA/DONGGUAN CD, LTD.				
REVISION	NO. 1	DATE	BY	CHKD BY	DATE
1	1	2024/10/20	1	1	2024/10/20